

## PRODUCT INFORMATION BULLETIN

**Issue Date** : 16th April 2026

**Bulletin Number** : PIB-01-2026

**Subject** : Vigil Cutter Service Life

**Background** :

Multiple Vigil units have been returned to our Service Department, and during inspection, the units were found with a replacement cutter that had a DOM older than 6 months prior to the DOM of the Vigil unit. Use of a cutter that is older than 6 months prior to the DOM of the Vigil unit could possibly result in the cutter exceeding its Service Life

**Compliance** :

Vigil cutters placed on any Vigil unit should not be older than 6 months prior to the DOM of the Vigil unit.


New or used Vigil AADs with a cutter DOM older than 6 months prior to the DOM of the Vigil unit should not be installed in any parachute rig.

If the age of the cutter exceeds 6 months prior to the DOM of the Vigil unit, the complete Vigil unit should be sent back to the factory for servicing and cutter replacement. For Vigil 2+ AADs, the cutter can be replaced in the field.

The expected Service Life of a Vigil cutter is 20 years + 6 months.

**Identification** :

Vigil Cutter DOM MM/YY

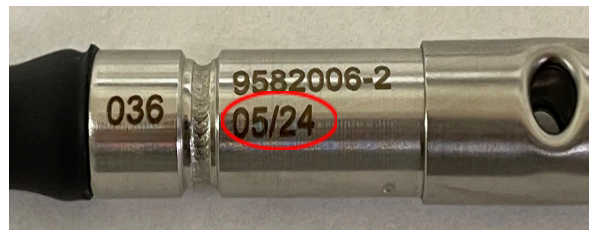



**Authority:**

Sven Ibens  
Managing Director

**AAD nv/sa** - Advanced Aerospace Designs  
220 Luikersteenweg, 3700, Tongeren, Belgium  
+32 12 210 250  
[info@vigil.aero](mailto:info@vigil.aero)

**Vigil America, Inc**  
1400 Flightline Blvd suite "C"  
Deland, FL 32724 - USA  
+1 386-736-8464  
[info@vigilamerica.com](mailto:info@vigilamerica.com)

[www.vigil.aero](http://www.vigil.aero)